

Yamaha CDR400 Firmware Version 1.0b

First Shipping version 1.0a:

New Release version 1.0b: Bug Fix:

- 1) If CDR400 has a CD in unit when Windows '95 or NT 4.0 loads, CDR400 is not seen by SCSI Host Adaptor when it scans for devcies.
- 2) Now supports abort from DAO recording by "Start_Stop Command" with eject option.
- 3) Fixed "buffer underrun" problem in TAO mode.
- 4) Now supports SCSI Disconnect/Reconnect during recording operation.
- 5) Improved speed-up read_CDDA operation performance.
- 6) CDR400 returns read error (SK=03h, ASC=06h, ASCQ=00h) on detecting "Run-out sector", "Link-sector", and "Run-in sector".
- 7) When no Lean-in is written, the CDR400 returns check condition error (SK=05h, ASC=24h, ASCQ=00h) to read TOC command with format=0, 1, and 2.