INTERNATIONAL TELECOMMUNICATION UNION

ITU-T

Q.675

TELECOMMUNICATION
STANDARDIZATION SECTOR
OF ITU

(03/93)

INTERWORKING OF SIGNALLING SYSTEMS

INTERWORKING OF SIGNALLING SYSTEMS – LOGIC PROCEDURES FOR INTERWORKING OF SIGNALLING SYSTEM R1 TO SIGNALLING SYSTEM No. 7 (ISUP)

ITU-T Recommendation Q.675

(Previously "CCITT Recommendation")

FOREWORD

The ITU Telecommunication Standardization Sector (ITU-T) is a permanent organ of the International Telecommunication Union. The ITU-T is responsible for studying technical, operating and tariff questions and issuing Recommendations on them with a view to standardizing telecommunications on a worldwide basis.

The World Telecommunication Standardization Conference (WTSC), which meets every four years, established the topics for study by the ITU-T Study Groups which, in their turn, produce Recommendations on these topics.

ITU-T Recommendation Q.675 was prepared by the ITU-T Study Group XI (1988-1993) and was approved by the WTSC (Helsinki, March 1-12, 1993).

_____

NOTES

1   As a consequence of a reform process within the International Telecommunication Union (ITU), the CCITT ceased to exist as of 28 February 1993. In its place, the ITU Telecommunication Standardization Sector (ITU-T) was created as of 1 March 1993. Similarly, in this reform process, the CCIR and the IFRB have been replaced by the Radiocommunication Sector.

In order not to delay publication of this Recommendation, no change has been made in the text to references containing the acronyms "CCITT, CCIR or IFRB" or their associated entities such as Plenary Assembly, Secretariat, etc. Future editions of this Recommendation will contain the proper terminology related to the new ITU structure.
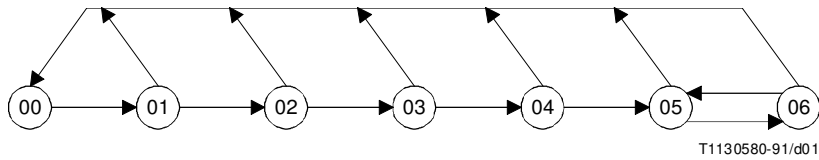
2   In this Recommendation, the expression "Administration" is used for conciseness to indicate both a telecommunication administration and a recognized operating agency.

© ITU 1994

INTERWORKING OF SIGNALLING SYSTEMS – LOGIC PROCEDURES FOR INTERWORKING OF SIGNALLING SYSTEM R1 TO SIGNALLING SYSTEM No. 7 (ISUP)

(Helsinki, 1993)

T1130580-91/d01

State number	State description	Sheet reference
00	Idle	1, 2, 3, 4, 5
01	Wait for CPCI	1
02	Wait for ST	2
03	Wait for address-complete	3
04	Wait for answer	3
05	Answer	4
06	Wait for resume (clear back)	5

FIGURE 1/Q.675

**State overview diagram for interworking of Signalling System R1
to Signalling System No. 7 (ISUP)**
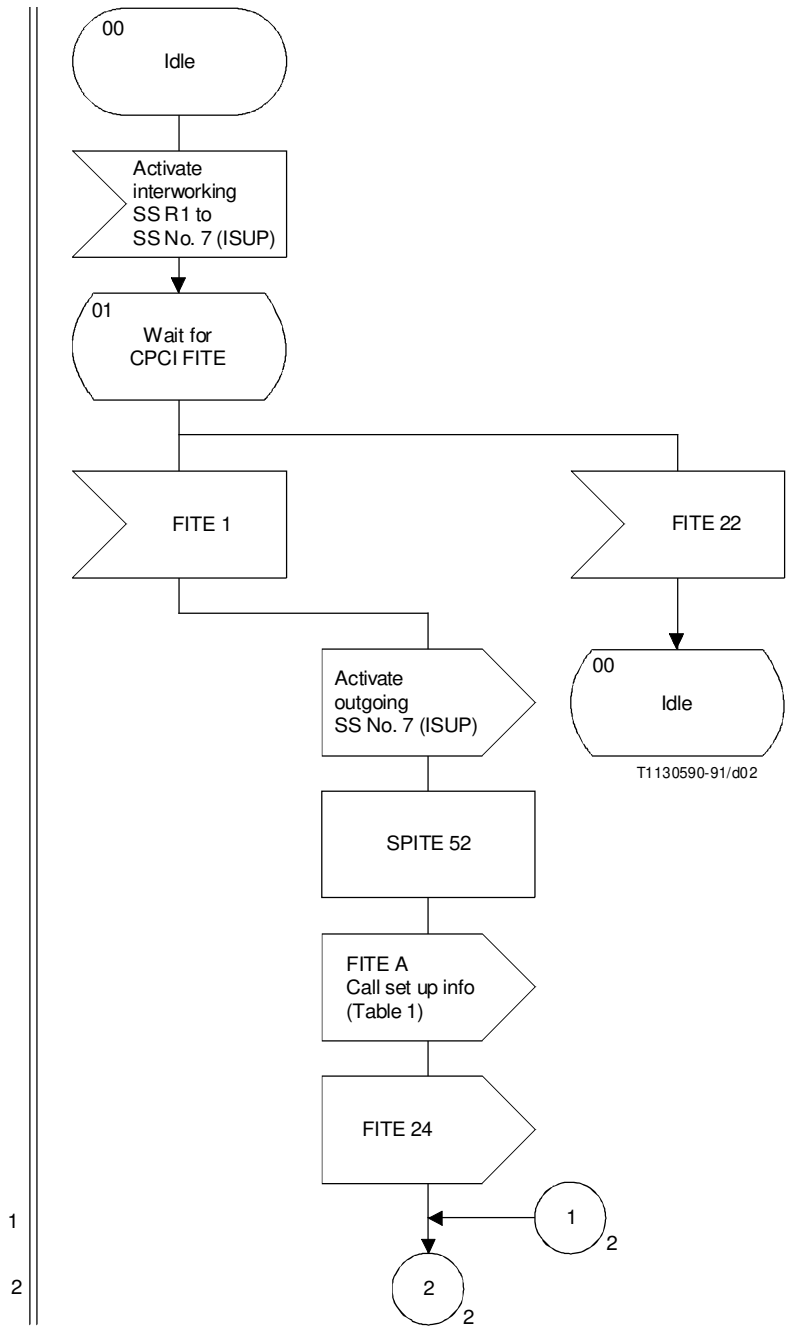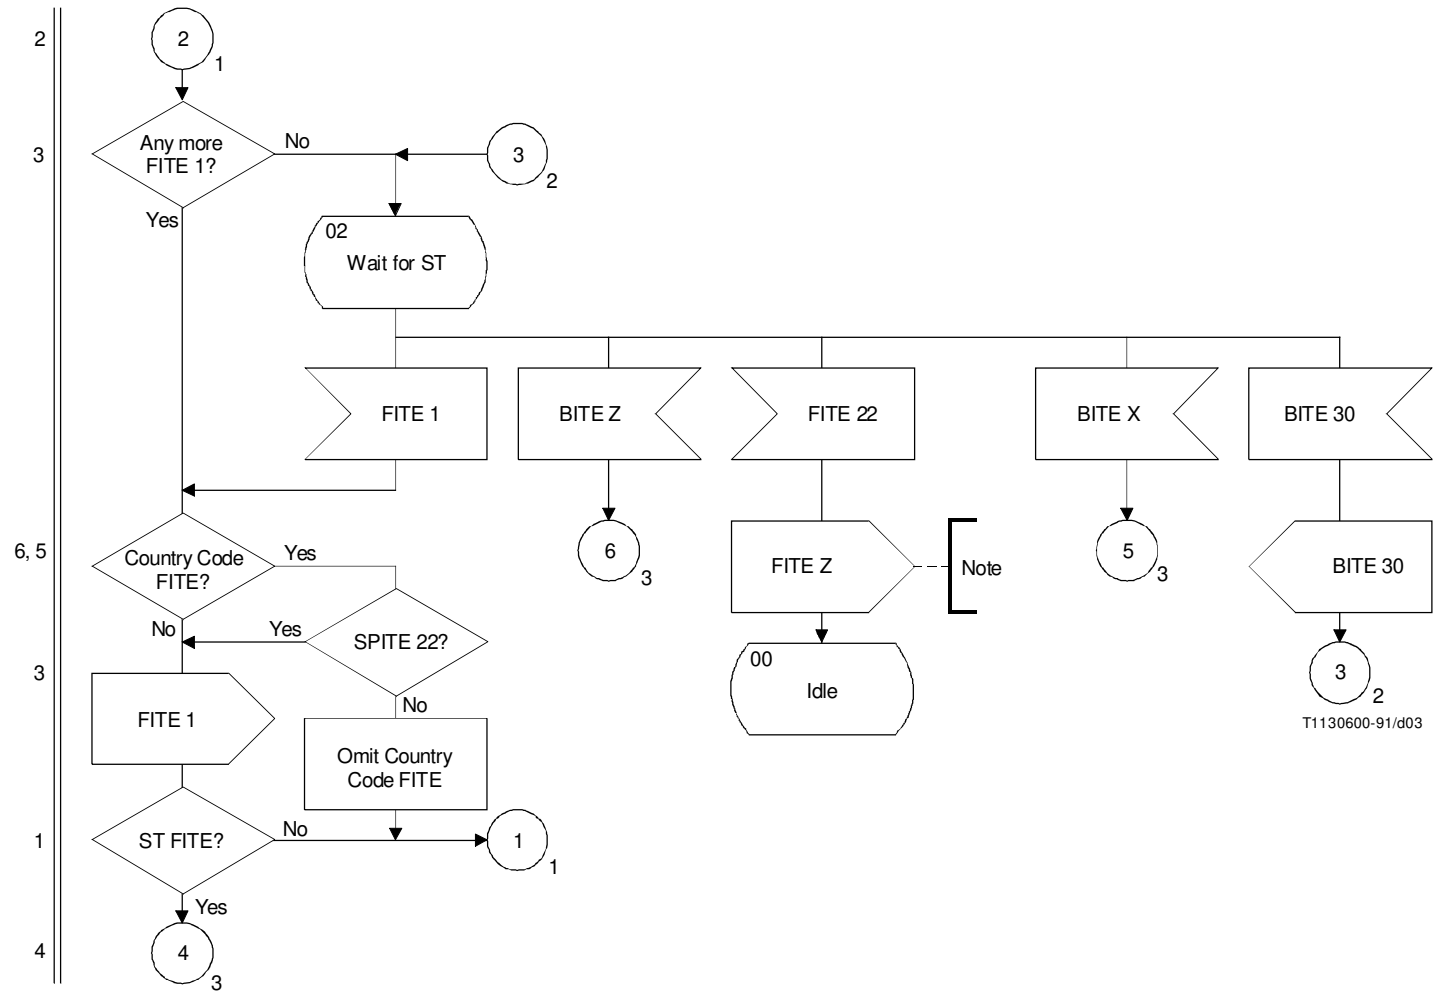
FIGURE 2/Q.675

(Reserved for future notes)

FIGURE 3/Q.675 (sheet 1 of 5)

Interworking of Signalling System R1 to Signalling System No. 7 (ISUP)

NOTE – In principle, FITE 22 should result in cause 16. However, in cases where FITE 22 results from a timeout expiry, cause 127 should be sent.

FIGURE 3/Q.675 (sheet 2 of 5)

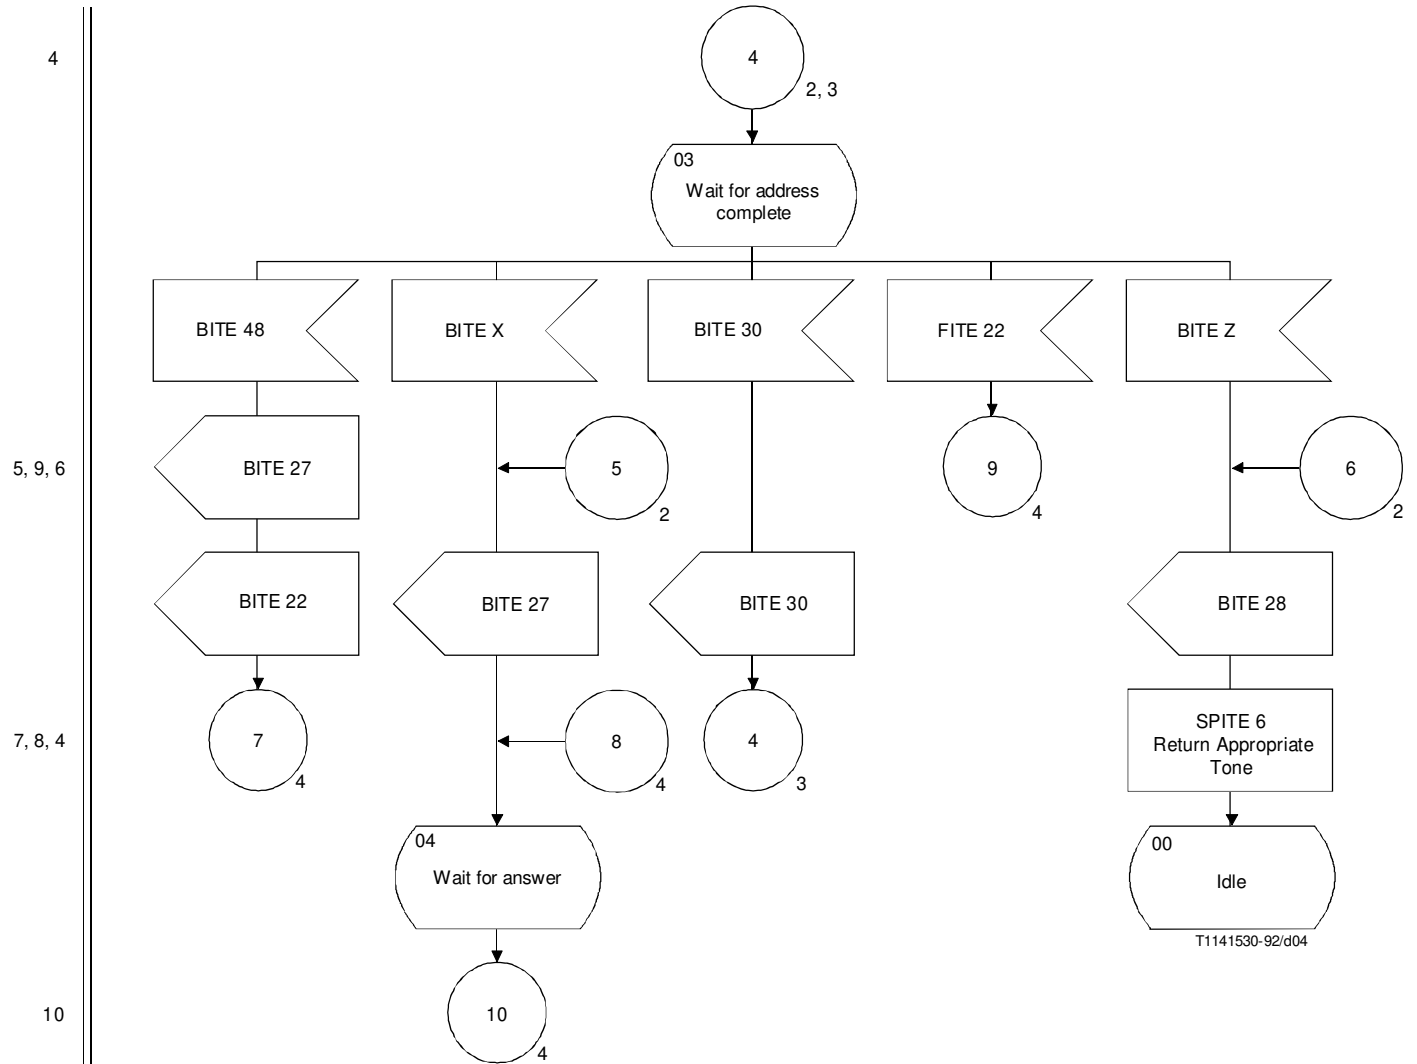**Interworking of Signalling System No. R1 to Signalling System No. 7 (ISUP)**
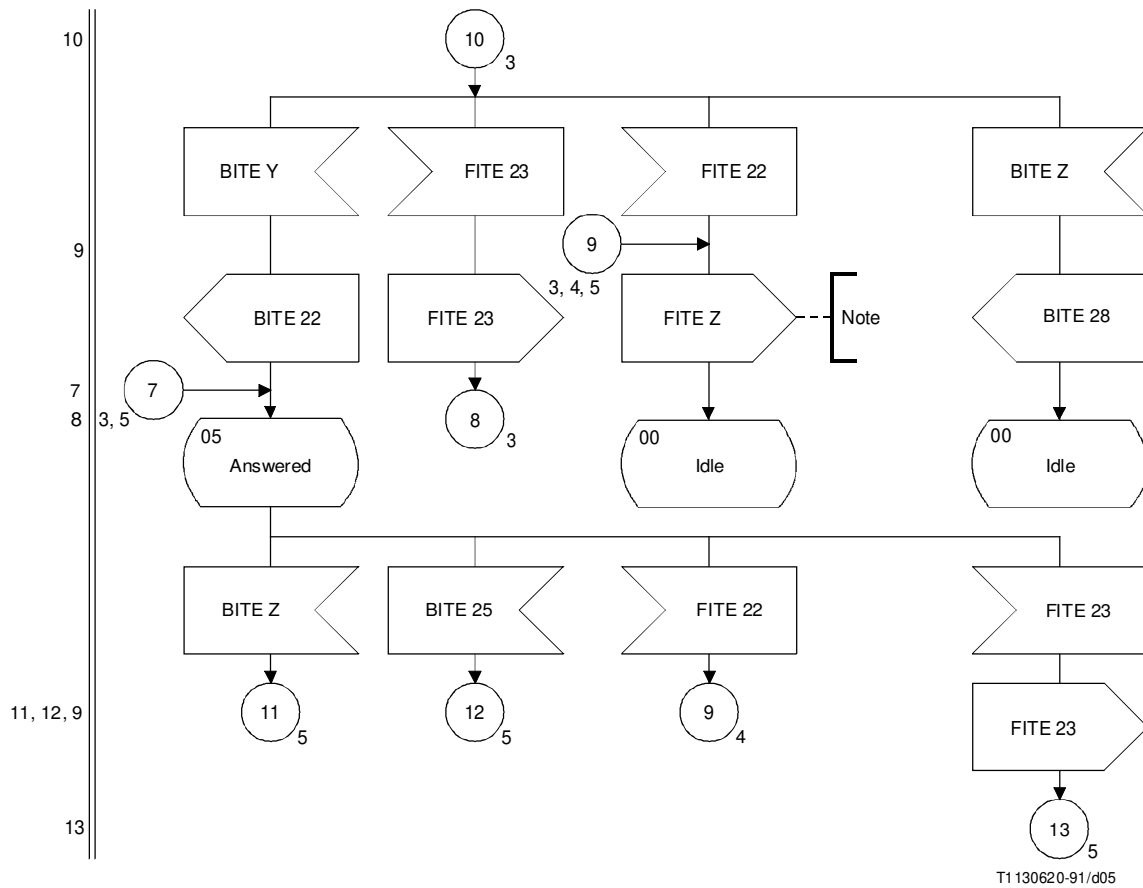
4

03
Wait for address
complete

2, 3

BITE 48

BITE X

BITE 30

FITE 22

BITE Z

5, 9, 6

BITE 27

5

2

9

4

6

2

BITE 22

BITE 27

BITE 30

BITE 28

7, 8, 4

7

4

8

4

4

3

SPITE 6
Return Appropriate
Tone

04
Wait for answer

00
Idle

T1141530-92/d04

10

10

4

FIGURE 3/Q.675 (sheet 3 of 5)

Interworking of Signalling System No. R1 to Signalling System No. 7 (ISUP)

NOTE – In principle, FITE 22 should result in cause 16. However, in cases where FITE 22 results from a timeout expiry, cause 127 should be sent.

FIGURE 3/Q.675 (sheet 4 of 5)

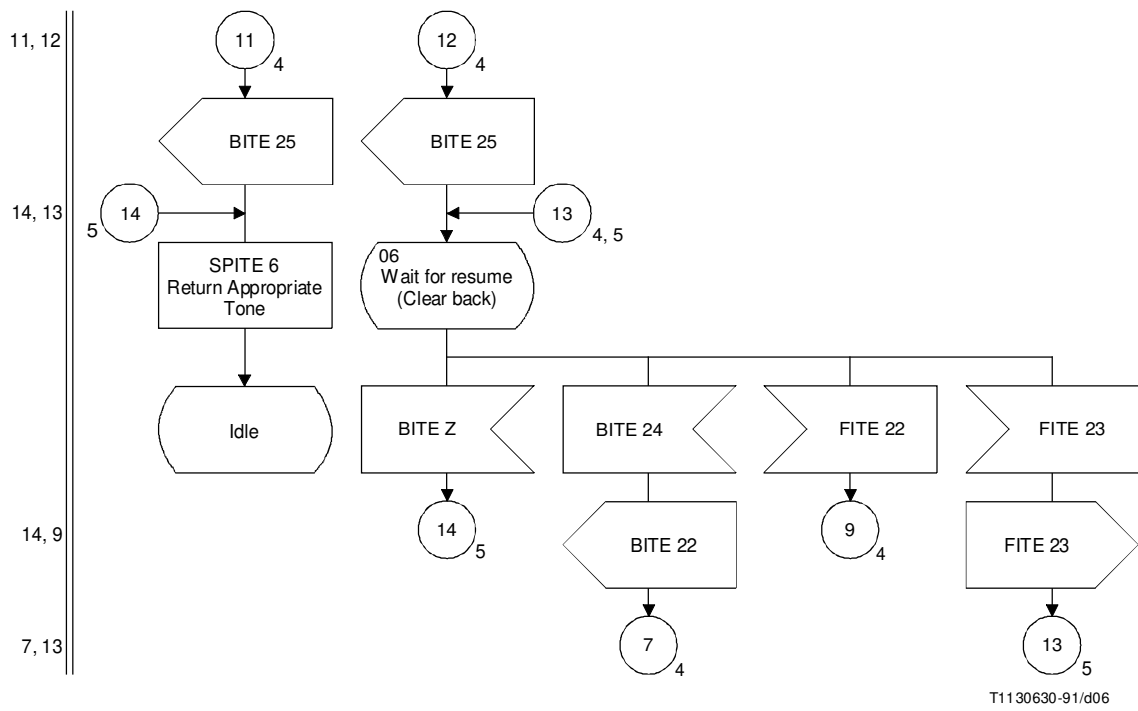**Interworking of Signalling System No. R1 to Signalling System No. 7 (ISUP)**

FIGURE 3/Q.675 (sheet 5 of 5)

Interworking of Signalling System No. R1 to Signalling System No. 7 (ISUP)

TABLE 1/Q.675

**FITE A construction – Interworking of Signalling
System R1 to Signalling System No. 7 (ISUP)**

SPITE 36	CCH
Yes No	01 10

SPITE 22	NAI
Yes No	100 011

SPITE 20	SI
Yes No	01 00

SPITE 21	ECI
Yes No	1 0

TMR = 11

CPC   Calling party's category

CCH   Continuity check indicator

NAI   Nature of address indicator

SI   Satellite indicator

ECI   Echo control indicator

TMR   Transmission medium requirement